

Product Information News

August 4, 2011

MSA POSI 3 USB UPGRADE KIT INFORMATION

Honeywell Analytics (formerly Sperian/Biosystems) has announced a fix for the intermittent communication errors encountered when testing SCBA with the Posi 3 USB testers.

The problem may be present in new Posi 3 USB testers purchased prior to 2011 or PosiChek3 testers that were upgraded to the Posi 3 USB prior to 2011.

Note: If your Posi 3 USB is not exhibiting signs of the communication issue, then you may wait to return the Posi 3 for yearly calibration.

The Posi 3 USB will be automatically upgraded when returned for yearly calibration.

If you **have** encountered communications errors while testing, see column 2 of this PIN Article for two options for obtaining a fix.

OPTION 1

Return the Posi 3 to Honeywell

Contact Honeywell Analytics Customer Service at 1-800-711-6776 to obtain an RMA to return the Posi 3 for upgrading.

Lead times may be 2-3 weeks depending on volume.

OPTION 2

Install the upgrade kit yourself

Contact Honeywell Analytics Customer Service at 1-800-711-6776 to request a kit.

UPGRADE KIT PART NUMBERS

54-58-101 Black Posi 3 USB
(Purchased as a Posi 3 USB)

54-58-102 Tan Posi 3 USB
(Upgraded from a Posichek3)

For Black Posi 3 USB units, the kit involves:

- Installation of a new ground tab for the USB connector on the Posi 3
- Upgrading the firmware on the Posi 3 main board

For Tan Posi 3 USB Units, the kit involves:

- Installation of a new internal USB cable assembly to the Posi 3
- Upgrading the firmware on the Posi 3 main board

The instructions can be found at:

http://www.sperian.com/Americas/Biosystems_Application_Notes_and_Advisories.aspx

For More Information, call 1-800-MSA-2222 or Visit Our Website at www.MSAnet.com



MINE SAFETY APPLIANCES COMPANY
CRANBERRY TWP., PENNSYLVANIA, U.S.A. 16066

© MSA 2011

Print Spec. 10000005389 (A) Mat. 10123136
Doc. 10123136