

SERVICE AND APPLICATION NOTES

100016

01/2021

Reduced CAI RPMs ON SL280UHNV & EL180UHNE -060, -080 and -100 Models

Beginning in August 2020, Lennox reduced the RPM on the inducers used on these model furnace. We feel this enhancement will provide you and the homeowner, a better experience with our products, improving sound and cold start challenges. OEM Repair Parts on LennoxPROS.com has been updated as well and will reflect the new 20M31 catalog number for these models. As noted on the chart below, SL280UHNV-100 models will require a new pressure switch with this upgrade. Warranty has been updated and these are a warranty replacement.

CAI Replacement Kit Required for 80% ULN Models			
Model	Dash Numbers	CAI Replacement Kit Required	Pressure Switch Required with CAI Replacement Kit
EL180UH040NE36A	-01, -03	16V36	N/A
EL180UH060NE36A	-01, -03	20M31	N/A
EL180UH080NE48B	-01, -03	20M31	N/A
EL180UH100NE60C	-01, -03	20M31	N/A
SL280UH060NV36A	-01, -03	20M31	N/A
SL280UH080NV48B	-01, -03	20M31	N/A
SL280UH080NV60C	-01, -03	20M31	N/A
SL280UH100NV60C	-01, -03	20M31	20K91
	-04	20M31	Already has 20K91*

* Dash -04 model factory equipped with pressure switch 20K91

If you have any questions please contact your Lennox representative, or Lennox Technical Support at (800)453-6669.

