

Inspection Notice

MSA Latchways® Guided Type Fall Arrester February 2024 PLEASE READ AND TAKE ACTION NOW

Dear Valued MSA Customer,

This Inspection notice is to inform you of a one-time inspection procedure regarding the locking pin on MSA Latchways® Guided Type Fall Arresters (GTFAs) that were manufactured between February 16, 2021 and January 30, 2024. Potentially affected models are listed in Table 1 below.

MSA has received a field report of an MSA Latchways GTFA that did not have a locking pin in the nut of the swivel connector between the carabiner and main body of the unit. Without this locking pin in place, there is potential for the connection to come loose during operation.

MSA has not received any reports of injuries associated with this condition. However, we are requesting that you perform the inspection outlined in this notice prior to next use.

Table 1: Potentially Affected Model Numbers

| Model Number | Material description |
|--------------|-----------------------------------|
| 3100L-00T | LADDERLATCH DEVICE |
| 3100L-00RU | LADDERLATCH ASSYLHAND MK11RUSSIA |
| 3103L-00 | CANADIAN LADDERLATCH ASSY L/H |
| 3104L-00 | LADDERLATCH DEVICE US (L/HAND) |
| 3100L-00AC | LADDERLATCH ASSY (L-HAND) MK2 |
| 3102L-00 | TOWERLATCH L/H DEVICE |
| 3100R-00 | LADDERLATCH ASSEMBLY MK2 -R/H |
| 3101R-00 | LADDERLATCH ASSEMBLY (R/HAND) MK2 |
| 85192-00 | CLIMBLATCH MK2 FINAL ASSEMBLY |
| 3102L-00BR | TOWERLATCH L/H DEVICE |
| 3105L-00 | TOWERLATCH WITH WEBBIING STROP US |
| 3102L-00AC | TOWERLATCH WITH WEBBING STROP |
| 35429-00 | TOWERLATCH S.P. |
| 85191-00 | CLIMBLATCH DEVICE |
| 85195-00 | CANADIAN CLIMBLATCH DEVICE |



Figure 1: GTFA

Inspection Procedure

1) **Confirm Model Number and Manufacturing Date** – Refer to Figure 2

a. Model Number

- i. Confirm that your model number is listed in Table 1.
- ii. If your model number is not listed, no further action is needed.

b. Manufacturing Date

- i. Confirm that your manufacturing date is between 16/02/2021 and 30/01/2024
- ii. If the date is outside of this range, no further action is needed.





MSA Corporate Center 1000 Cranberry Woods Drive Cranberry Township, PA 16066 800.MSA.2222 www.MSAsafety.com

Figure 2: GTFA Inspection Data

- 2) **Inspect the product** Visually inspect the swivel connector of the unit for the presence of the silver locking pin.
 - a. Locking pin is present (Figure 3) no further action is needed.
 - b. Locking pin is not present (Figure 4) remove the product from service and follow the procedure below for a replacement unit.



Figure 3: Locking Pin is Present



Figure 4: Locking Pin Missing



Replacing Affected GTFA units

MSA Corporate Center

To receive a replacement free of charge for affected units, please scan the QR code ¹⁰⁰⁰ Cranberry Woods Drive and complete the GTFA Replacement Form. You may submit multiple forms if more than one model is affected.

Scan code or click the link: GTFA Replacement Form



MSA Customer Service Contact Information

If you have any questions regarding this Inspection Notice, please contact us as shown below:

US and Canada: call 866-672-0005 or Email us at <u>ProductSafetyNotices@msasafety.com</u>

Europe, Middle East, and Africa: Email us at <u>ProductUserNotice@msasafety.com</u> or contact your local MSA customer service representative

All other regions:

Contact your local MSA customer service representative.

Your safety and continued satisfaction are important to us, and we apologize for any inconvenience that this may have caused.

Best regards,

Adam Troup Product Safety Manager