



Tech TIPS

SUPPORTING TODAY'S PROFESSIONAL TECHNICIAN

Don't Reuse Torque-type CV Axle Nuts

Application:

Front wheel drive vehicles with prevailing torque-type retaining unit.

Problem:

Outer Constant Velocity stub shaft has movement in and out with resulting clunking and damage to the outer joint.


Cause:

Reuse of retaining nut of a prevailing torque type.

Solution:

Discard old retaining torque-type nut and always use a new one.

Prevailing torque-type nut

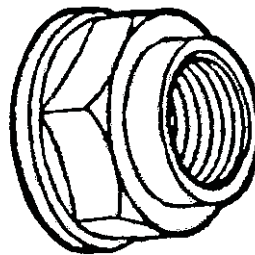

Do Not Reuse

Note:

Prevailing torque-type hardware will be supplied on applications where required.