



Tech TIPS

SUPPORTING TODAY'S PROFESSIONAL TECHNICIAN

Power Steering Binding or Lack of Assist After Installation

Application:

All vehicles with Power Steering.

Problem:

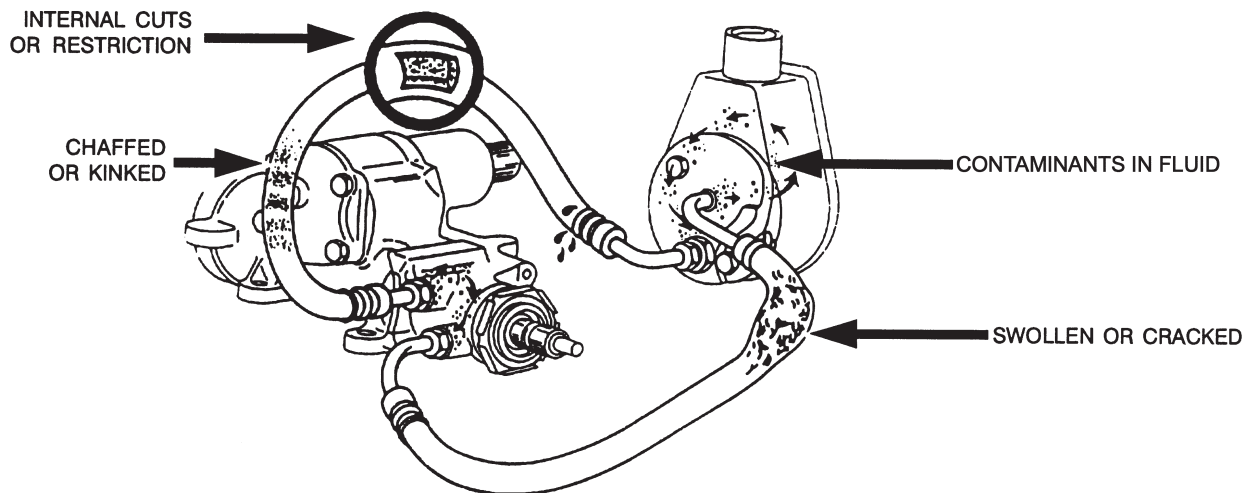
Binding, poor return ability, leaking, stiff steering, noise or fluid overheating.

Cause:

Restricted flow of hydraulic fluid. Kinked or damaged line or accumulation of grit and debris, block proper flow of fluid through Power Steering System.

Solution:

Check hose routing and condition. Make sure all lines are O.E. Specification. Before installing any replacement unit, flush the entire system and replace **ALL** hoses.

**Note:**

CONTAMINATED FLUID COULD CAUSE THE SAME SYMPTOMS. ALWAYS FLUSH THE ENTIRE SYSTEM AND INSTALL A POWER STEERING FILTER.